



INSTRUCTION SHEET



STEP 1
Strip a minimum of 25mm of jacket from the end of the cable. (Note: IDC only for 22-26 AWG solid wires.)

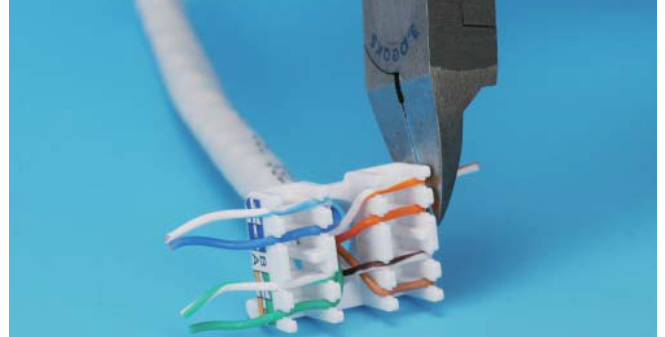


STEP 2
Insert the wires into their correct positions based upon the color code. Cut the excess wire off as close to the edge of the cap as possible. (The tips of the wires should protrude no more than 0,5 mm.)

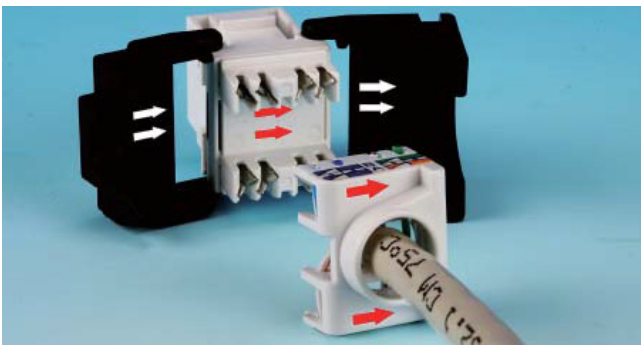

STEP 3
Make sure that the arrows on the jack and the cap face in the same direction.



STEP 4
Align the cap with the IDC towers and press it into position.

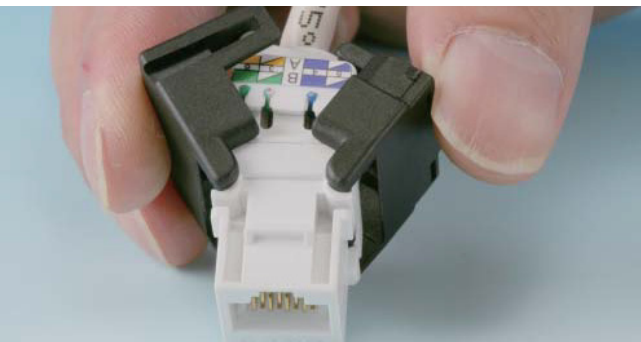

STEP 5
Rotate the wings toward each other until they snap closed.



STEP 6
In order to open the connector clip, horizontally insert a screwdriver into the top horizontal slot and rotate it for loosening one side. Then insert this screwdriver by the same way to the slot in the other side. Rotate it until the cap opens.